



University of Hail
Laboratory
Industrial Engineering Department
Practical Exercise and Procedures of
Computer Integrated Manufacturing (CIM)



Laboratory 4

Department of Industrial Engineering

Syllabus

CIM & AUTOMATION LAB

PART – A

CNC part programming using CAM packages. Simulation of Turning, Drilling, Milling operations. 3 typical simulations to be carried out using simulation packages like Master- CAM, or any equivalent software.

PART – B

(Only for Demo/Viva voce)

1. FMS (Flexible Manufacturing System): Programming of Automatic storage and Retrieval system (ASRS) and linear shuttle conveyor Interfacing CNC lathe, milling with loading unloading arm and ASRS to be carried out on simple components.
2. Robot programming: Using Teach Pendant & Offline programming to perform pick and place, stacking of objects, 2 programs.

PART – C

(Only for Demo/Viva voce)

Pneumatics and Hydraulics, Electro-Pneumatics: 3 typical experiments on Basics of these topics to be conducted.

INDEX PAGE

Sl.No	Name of the Experiment	Date			(Faculty) Signature	(Student) Signature	(Max. 10) Record Marks	(Max . 25) Manual Marks
		Conduction	Repetition	Submission of Record				
Average								

Note: If the student fails to attend the regular lab, the experiment has to be completed in the same week. Then the manual/observation and record will be evaluated for 50% of maximum marks.

Department of Industrial Engineering

OBJECTIVES

The objectives of Computer Integrated Manufacturing and Automation laboratory is

- ✓ to demonstrate the concepts discussed in Computer Integrated Manufacturing course.
 - ✓ to introduce CNC part programming for simulation of various machining operations.
 - ✓ to educate the students on Flexible Manufacturing System and Robot Programming.
 - ✓ to educate the students on the hydraulics, pneumatics and electro– pneumatic systems.
-

OUTCOMES

The expected outcome of Computer Integrated Manufacturing and Automation lab is that the students will be able

- ✓ to practically relate to concepts discussed in Computer Integrated Manufacturing course.
- ✓ to write CNC part programs using CADEM simulation package for simulation of machining operations such as Turning, Drilling & Milling.
- ✓ to understand & write programs for Flexible Manufacturing Systems & Robotics.
- ✓ to understand the operating principles of hydraulics, pneumatics and electro– pneumatic systems.
- ✓ to apply these learning's to automate & improve efficiency of manufacturing process.

General instruction to Students

- ☐ Students are informed to present 5 min before the commencement of lab.
- ☐ Students must enter their name in daily book before entering into lab.
- ☐ Students must leave Foot wares before entering lab.
- ☐ Students must not carry any valuable things inside the lab.
- ☐ Students must inform lab assistant before He/She uses any computer.
- ☐ Do not touch anything with which you are not completely familiar. Carelessness may not only break the valuable equipment in the lab but may also cause serious injury to you and others in the lab.
- ☐ For any software/hardware/ Electrical failure of computer during working, report it immediately to your supervisor. Never try to fix the problem yourself because you could further damage the equipment and harm yourself and others in the lab.
- ☐ Students must submit Record book for evaluation before the commencement of lab.
- ☐ Students must keep observation book (if necessary).
- ☐ Students must keep silent near lab premises.
- ☐ Students are informed to follow safety rules.
- ☐ Students must obey lab rules and regulations.
- ☐ Students must maintain discipline in lab.
- ☐ Do not crowd around the computers and run inside the laboratory.
- ☐ Please follow instructions precisely as instructed by your supervisor. Do not start the experiment unless your setup is verified & approved by your supervisor.

Contents

<i>Syllabus</i>	<i>i</i>
<i>Index</i>	<i>ii</i>
<i>Course Objectives & Outcomes</i>	<i>iii</i>
<i>General instruction to Students</i>	<i>iv</i>
<i>Contents</i>	<i>v</i>
Introduction	1
CNC Turning exercises	19
CNC Milling exercises	27
Questions	38
References	44

INTRODUCTION

Numerical control :(NC)


It can be defined has form of programmable automation in which the process is controlled by numbers, letters and symbols in NC the numbers forms a program of instructions designed for a particular work part or job.

When the job changes the program of instruction is changed. This capability will change program for each new job is what gives NC flexibility.

Ex: GOO XO YO ZO

Computer numerical control :(CNC)

Numerical control integrated computer control includes one or more microprocessor, mini computers. The logic function or program the control comprises a program that is stored in the memory.

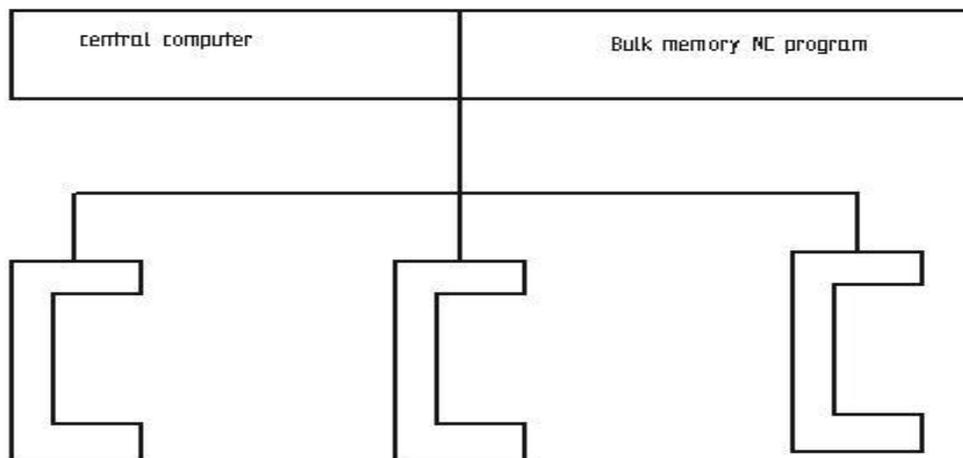

Direct numerical control: (DNC)

It can be defined has a manufacturing system in which a number of machines are controlled by a computer through direct connection & in real time.

NC motion control system:


In NC there are 3 basic types of machine control system

1. Point to Point
2. Straight cut
3. Contouring

1) Point to point


It is also sometimes called positioning system. In point to point the objective of the machine tool control system is to the cutting to pre defined location once the tool reaches the defined location the machining operation is performed at that position.

EX: NC drill presses.

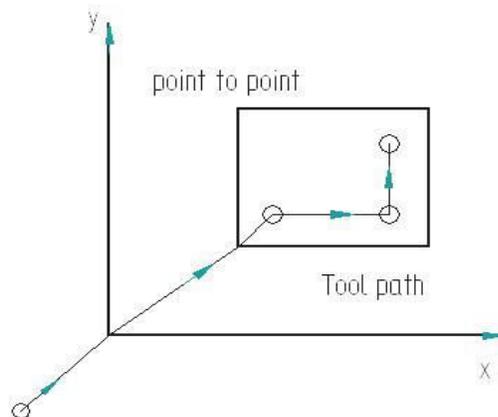

2) Straight cut NC

Straight cut control system is capable of moving the cutting tool, parallel to one of the major axes at controlled rate suitable for machining. It is therefore appropriate for performing milling operation to fabricate work piece of rectangular configurations.

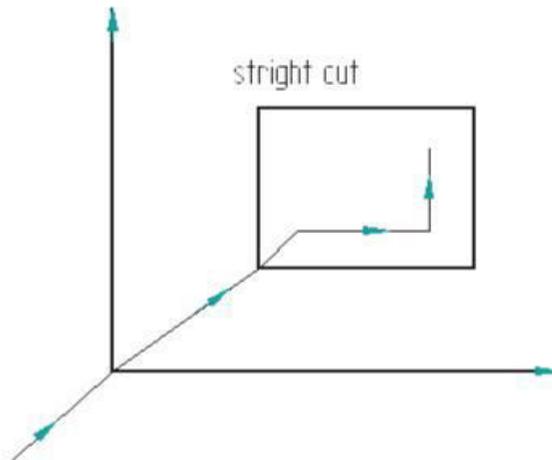

FUNDAMENTALS OF PART PROGRAMMING

NUMERICAL CONTROL PROCEDURE

The following are the basic steps in NC procedure

- Process Planning
- Part Programming
- Part Program entry
- Proving the part program
- Production

A) PROCESS PLANNING

The part programmer will often carry out the task of process planning. Process planning is the procedure of deciding what operations are to be done on the component, in what order, and with what tooling and work holding facilities. Both the process planning and part programming aspects of manufacture occur after the detail drawings of a component have been prepared. The following procedure may be used as a guide to assist the programmer, by describing each step required in preparing the method of production.

PROCESS PLANNING

<ul style="list-style-type: none"> • Receive the part drawing from part drawing information, check suitability of part to be machined against the machine capacity.
<ul style="list-style-type: none"> • Determine a method of driving the component (chuck type, chuck size, type of jaw) and the method of machining.
<ul style="list-style-type: none"> • Determine the tooling required to suit the method of machining and utilize as much as possible the tools which are permanently in the turret set upon the machine.
<ul style="list-style-type: none"> • Determine the order of machining and the tooling stations.
<ul style="list-style-type: none"> • Determine planned stops for checking dimensional sizes where required by operator
<ul style="list-style-type: none"> • Determine cutting speeds based on <ul style="list-style-type: none"> - Component material, method of driving, rigidity of component - Tooling selected for roughing and finishing
<ul style="list-style-type: none"> • Determine the depths of cut and feeds for roughing operations
<ul style="list-style-type: none"> • Determine surface finish requirements, the cutter nose radius most suited for finishing operations and determine feed rates.
<ul style="list-style-type: none"> • Allocates tool offsets as required
<ul style="list-style-type: none"> • Complete planning sheet

B) PART PROGRAMMING

<ul style="list-style-type: none"> • After completing the planning sheet, draw the component showing the cutter paths (a simple sketch is sufficient for simple components)
<ul style="list-style-type: none"> • Select a component datum and carryout the necessary calculations at slopes and arcs.
<ul style="list-style-type: none"> • Prepare tooling layout sheet showing tools to be used in the program and indicate the station number for each tool.
<ul style="list-style-type: none"> • Indicate the ordering code for each tool and grade and type of inserts to be used.
<ul style="list-style-type: none"> • Write the part program according to the sequence of operations.

C) PART PROGRAM ENTRY (OR) TAPE PREPARATION

The part program is prepared / punched on a 25 mm wide paper tape with 8 tracks and is fed to MCU in order to produce a component of interest on machine tool. Other forms of input media include, punched cards, magnetic tape, 35 mm motion picture film. The input to the NC system can be in two ways:

1. Manual data input
2. Direct Numerical control.

1) Direct Data Input (MDI): Complete part programs are entered into CNC control unit via the console keyboard. It is suited only for relatively simple jobs. The most common application for MDI is the editing of part programs already resident in controllers memory.

One variation of MDI is a concept called “Conversational Programming”. CNC machines are programmed via a question and answer technique whereby a resident software program asks the operator a series of questions. In response to the operators input, and by accessing a pre-programmed data file, the computer control can.

- Select numerical values for use within machining calculations
- Perform calculations to optimize machining conditions
- Identify standard tools and coordinates
- Calculate cutter paths and coordinates
- Generate the part program to machine the component

A typical dialogue from the machine would be as follows for the operator to identify such things as:

- Material to be cut
- Surface roughness tolerance
- Machined shape required
- Size of the raw material blank
- Machining allowances, cut directions
- Tools and tool detail etc.

The operator may then examine and prove the program via computer graphics simulation on the console VDU. After this, the program is stored or punched on tape. Although there is some sacrifice in machine utilization, actual programming time is minimal and much tedious production engineering work is eliminated.

2) Direct Numerical Control: The process of transferring part programs into memory of a CNC machine tool from a host computer is called Direct Numerical Control or DNC

D) PROVING PART PROGRAMS

It is safe practice to check the programmed path for any interference between the tool and the work before using the part program for production. The proving part program is done by:

- | |
|---|
| <ul style="list-style-type: none">- Visual inspection- Single step execution- Dry run- Graphical simulation. |
|---|

Visual Inspection: It represents the method of checking visually the program present in the memory of the CNC machine. In this, actual program is run and the programmed movements in all axes are to be checked along with ensuring the tool offset and cutter compensation feature. This method represents the least form of verification and should not be relied up on entirely.

Single Step Execution: Before auto-running the part program it should be executed in a step mode i.e. block by block. During this execution, spindle speed and feed rate override facilities are to be used so that axes movement can be easily monitored. This operation may be carried out with or without mounting the component on the machine.

Dry run: A dry run consists of running the part program in auto-mode. During this, the component is not installed on the machine table and the cutting is done in air. The purpose of this run is to verify the programmed path of the tool under continuous operation and to check whether adequate clearance exist between the clamping arrangement and other projections

within the set up. Feed rate override facilities are used to slow down the speed of execution of the program.

Graphical simulation: A graphical simulation package emulates the machine tool and, using computer graphics, plots out the machine movements on a VDU screen. Machine movement often takes the form a cutting tool shape moving around the screen according to the programmed movements. When the tool shape passes over a shaded representation of the component, it erases that part of the component. The resulting shape, left after the execution represents the shape of the finished component. Any gross deviations from the intended tool path can be observed and any potential interference can be highlighted.

PART PROGRAMMING GEOMETRY FOR TURNING

A. COORDINATE SYSTEM FOR A CNC LATHE.

Machining of a work piece by an NC program requires a coordinate system to be applied to the machine tool. As all machine tools have more than one slide, it is important that each slide is identified individually. There are two planes in which movements can take place

- Longitudinal.
- Transverse.

Each plane is assigned a letter and is referred to as an axis,

- Axis X
- Axis Z

The two axis are identified by upper case X, Z and the direction of movement along each axis (+) or (-). The Z axis is always parallel to the main spindle of the machine. The X axis is always parallel to the work holding surface, and always at right angles to the Z axis. The coordinate system for turning operations is shown in figure below


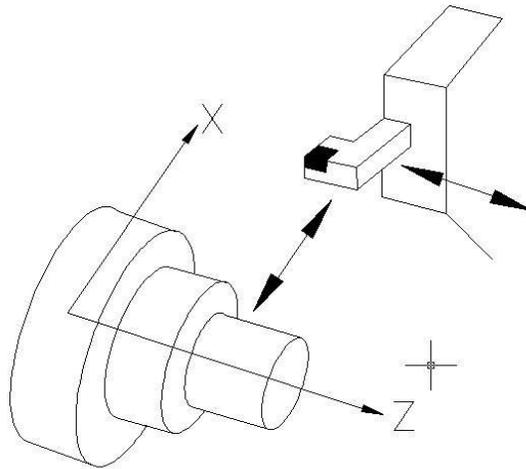


Fig 1. COORDINATE SYSTEM FOR TURNING OPERATIONS

B. ZERO POINTS AND REFERENCE POINTS

All CNC machine tool traverses are controlled by coordinating systems. Their accurate position within the machine tool is established by “ZERO POINTS”.

MACHINE ZERO POINT (M): is specified by the manufacturer of the machine. This is the zero point for the coordinate systems and reference points in the machine. On turning lathes, the machine zero point is generally at the center of the spindle nose face. The main spindle axis (center line) represents the Z axis; the face determines the X axis. The directions of the positive X and Z axes point toward the working area as shown in figure below:

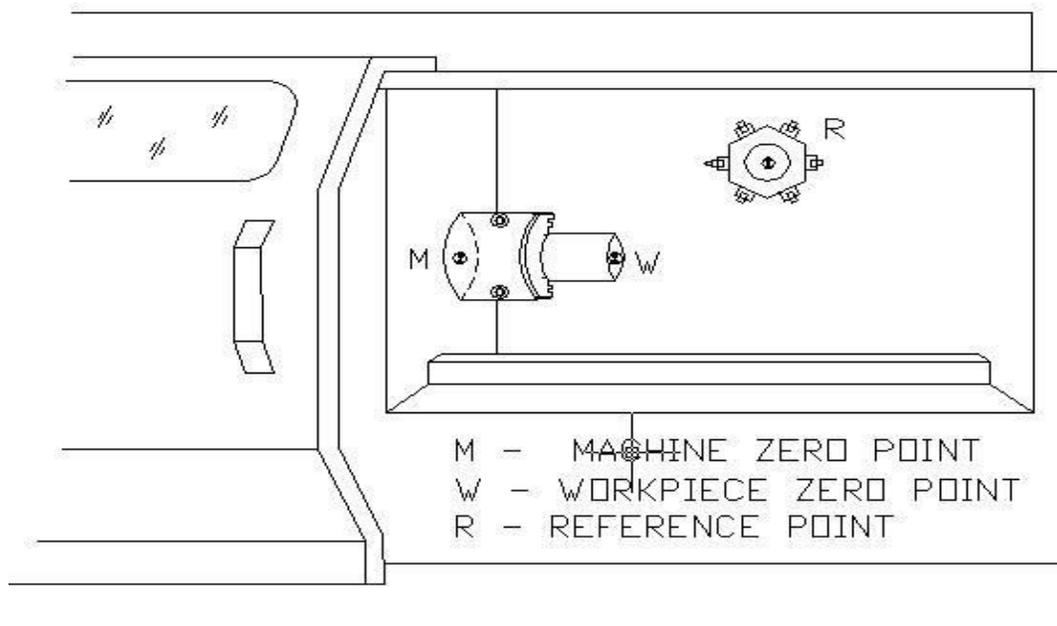

WORKPIECE ZERO POINT (W): This point determines the workpiece coordinate system in relation to the machine zero point. The workpiece zero point is chosen by the programmer and input into the CNC system when setting up the machine. The position of the workpiece zero point can be freely chosen by the programmer within the workpiece envelope of the machine. It is however advisable to place the work piece zero point in such a manner that the dimensions in the workpiece drawing can be conveniently converted into coordinate values and orientation when clamping / chucking, setting up and checking, the traverse measuring system can be effected easily.

For turned parts, the work piece zero point should be placed along the spindle axis (center line), in line with the right hand or left hand end face of the finished contour as shown in figure. Occasionally the work piece zero point is also called the “program zero point.”

REFERENCE POINT (R): This point serves for calibrating and for controlling the measuring system of the slides and tool traverses. The position of the reference point as shown in figure below is accurately predetermined in every traverse axis by the trip dogs and limit switches. Therefore, the reference point coordinates always have the same , precisely known numerical value in relation to the machine zero point. After initiating the control system, the reference point must always be approached from all axes to calibrate the traverse measuring system. If current slide and tool position data should be lost in the control system as for example, through an electrical failure, the machine must again be positioned to the reference point to re-establish the proper positioning values.

PREPARATORY FUNCTION (G-Codes).

G CODES	
G00	Positioning (Rapid Transverse)
G01	Linear Interpolation (Feed)
G02	Circular Interpolation (CW)
G03	Circular Interpolation (CCW)
G04	Dwell
G20	Inch Data Input
G21	Metric Data Input
G28	Reference point return
G40	Tool nose radius compensation cancel
G41	Tool nose radius compensation left

G42	Tool nose radius compensation right
G50	Work coordinate change/ Max. Spindle speed setting
G70	Finishing cycle
G71	Multiple Turning Cycle in turning
G72	Stock removal in facing
G73	Pattern repeating
G74	Peck drilling in Z axis
G75	Grooving in X axis
G76	Thread cutting cycle
G90	Cutting cycle A (Turning)
G94	Cutting cycle B (Facing)
G96	Constant surface speed control
G97	Constant surface speed control cancel
G98	Feed per minute
G99	Feed per revolution

MISCELLANEOUS FUNCTION (M Codes)

M Codes are instructions describing machine functions such as calling the tool, spindle rotation, coolant on, door close/open etc.

M CODES	
M00	Program Stop
M02	Optional Stop
M03	Spindle Forward (CW)
M04	Spindle Reverse (CCW)
M05	Spindle Stop
M06	Tool Change
M08	Coolant On
M09	Coolant Off
M10	Vice Open
M11	Vice Close
M13	Spindle Forward, Coolant On
M14	Spindle Reverse, Coolant On
M30	Program End
M38	Door Open
M39	Door Close
M98	Subprogram Call
M99	Subprogram Exit

COMPUTERISED NUMERICAL CONTROL MILLING

PART PROGRAMMING FUNDAMENTALS

1. PART PROGRAMMING GEOMETRY

COORDINATE SYSTEM FOR A CNC MILL


Machining of a work piece by an NC program requires a coordinate system to be applied to the machine tool. As all machine tools have more than one slide, it is important that each slide is identified individually. There are three planes in which movement can take place.

- Longitudinal
- Vertical
- Transverse

Each plane is assigned a letter and is referred to as an axis, i.e,

- Axis X
- Axis Y
- Axis Z

The three axes are identified by upper case X, Y and Z and the direction of movement along each axis is specified as either '+' or '-'. The Z axis is always parallel to the main spindle of the machine. The X axis is always parallel to the work holding surface, and always at right angles to the Z axis. The Y axis is at right angles to both Z and X axis. Figure shows the coordinate system for milling.

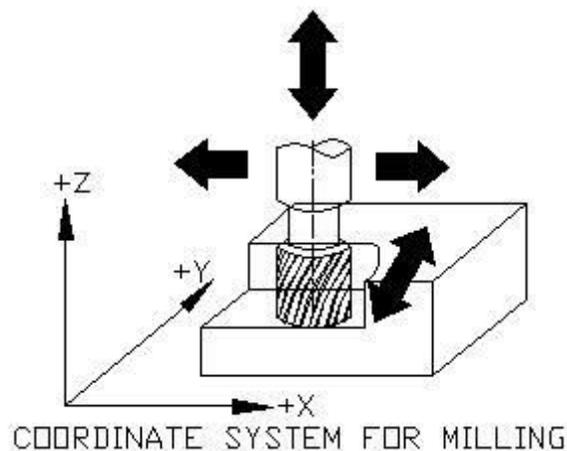

B. ZERO POINTS AND REFERENCE POINTS

MACHINE ZERO POINT (M): This is specified by the manufacturer of the machine. This is the x zero point for the coordinate systems and reference points in the machine. The machine zero point can be the center of the table or a point along the edge of the traverse range as shown in figure the position of the machine zero point generally varies from manufacture. The precise position of the machine zero point as well as the axis direction must therefore be taken from the operating instructions provided for each individual machine.

REFERENCE POINT (R): this point serves for calibrating and for controlling the measuring system of the slides as tool traverses. The position of the reference point is accurately predetermined in every traverse axis by the trip dogs and limit switches. Therefore, the reference point coordinates always have the same, precisely known numerical value in relation to the machine zero point. After initiating the control system, the reference point must always be approached from all axes to calibrate the traverse measuring system. If current slide and tool position data should be lost in the control systems, for example, through an electrical failure, the machine must again be positioned to the reference point to re-establish the proper positioning values.

WORKPIECE ZERO POINT (W): This point determines the work piece coordinate system in relation to the machine zero point. The work piece zero point is chosen by the programmer and input into the CNC system when setting up the machine. The position of the work piece zero point can be freely chosen by the programmer within the work piece envelope of the machine. It is however, advisable to place the work piece zero point in such a manner that the dimensions in the work piece drawing can be conveniently converted into coordinate values and orientation when clamping/ chucking, setting up and checking the traverse measuring system can be affected easily. For milled parts, it is generally advisable to use an extreme corner point as the “work piece zero point”. Occasionally, the work piece zero point is called the “program zero point”

NC- RELATED DIMENSIONING

Dimensional information in a work piece drawing can be stated in two ways:

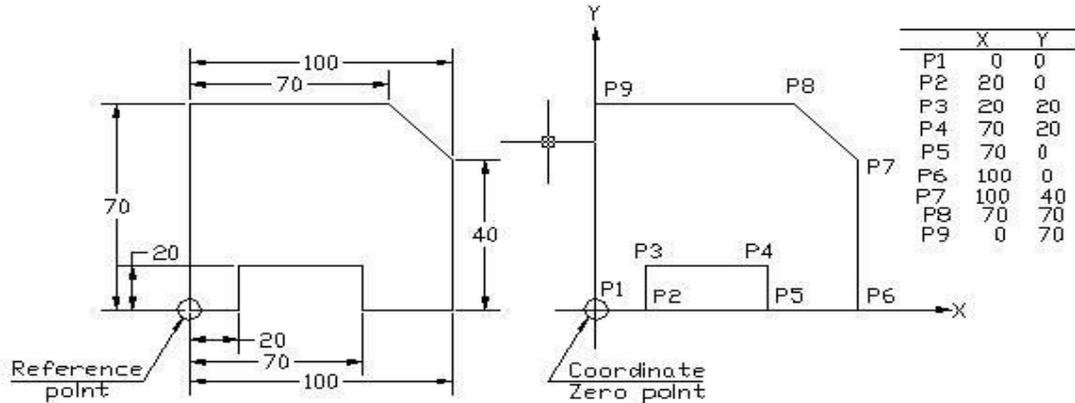


Fig A. Absolute Dimensions

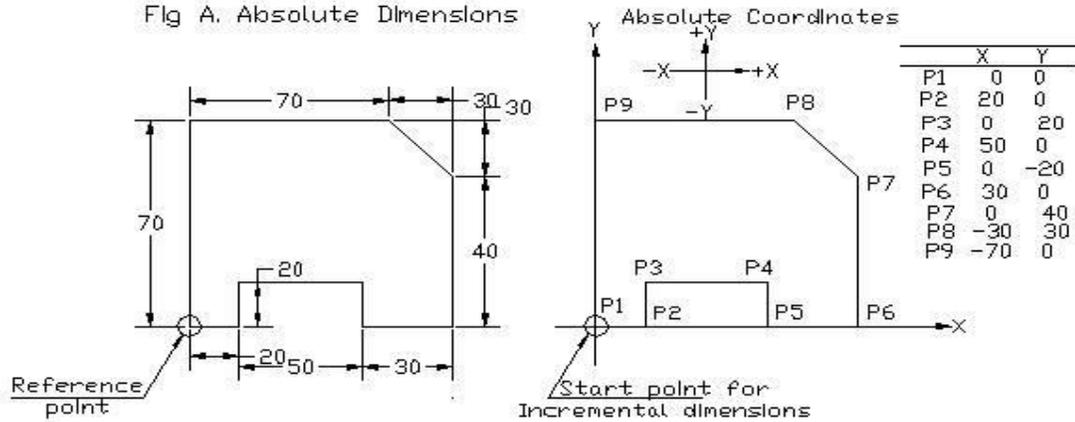


Fig B. Incremental Dimensions

Incremental Coordinates

1. Absolute Dimension System: Data in absolute dimension system always refer to a fixed reference point in the drawing as shown in figure A above. This point has the function of a coordinate zero point as in figure B. The dimension lines run parallel to the coordinate axes and always start at the reference point. Absolute dimensions are also called as “Reference dimensions”.

2. Incremental Dimension System: When using incremental dimension system, every measurement refers to a previously dimensioned position as shown in figure A below. Incremental dimensions are distance between adjacent points. These distances are converted into incremental coordinates by accepting the last dimension point as the coordinate origin for the new point. This may be compared to a small coordinate system, i.e. shifted consequently from point to point as shown in figure B. Incremental dimensions are also frequently called “Relative dimensions” or “Chain dimensions”.

PREPARATORY FUNCTIONS (G CODES)

G CODES	
G00	Positioning (Rapid Transverse)
G01	Linear Interpolation (Feed)
G02	Circular Interpolation (CW)
G03	Circular Interpolation (CCW)
G04	Dwell
G20	Inch Data Input
G21	Metric Data Input
G28	Reference point return
G40	Tool nose radius compensation cancel
G41	Tool nose radius compensation left
G42	Tool nose radius compensation right
G43	Tool length compensation + direction
G44	Tool length compensation - direction
G73	Peck drilling cycle
G74	Counter tapping cycle
G76	Fine Boring
G80	Canned cycle cancel
G81	Drilling cycle, spot boring
G82	Drilling cycle, counter boring
G83	Peck drilling cycle
G84	Tapping cycle
G85	Boring cycle
G86	Boring cycle
G87	Back boring cycle
G88	Boring cycle

G89	Boring cycle
G90	Absolute command
G91	Incremental command
G92	Programming of Absolute zero point.
G94	Feed per minute
G95	Feed per revolution
G98	Return to initial point in canned cycle
G99	Return to R point in canned cycle.

MISCELLANEOUS AND PREPARATORY FUNCTIONS

M Codes are instructions describing machine functions such as calling the tool, spindle rotation, coolant on, door close/open etc.

M CODES	
M00	Program stop
M01	Optional stop
M02	Program end
M03	Spindle forward
M04	Spindle reverse
M05	Spindle stop
M06	Tool change
M08	Coolant on
M09	Coolant off
M10	Vice open
M11	Vice close
M13	Coolant, spindle fwd
M14	Coolant, spindle rev
M30	Program stop and rewind

M70	X mirror On
M71	Y mirror On
M80	X mirror off
M81	Y mirror off
M98	Subprogram call
M99	Subprogram exit

From the drawing to the workpiece


1. Reading drawing




2. Programming



3. Inputting program

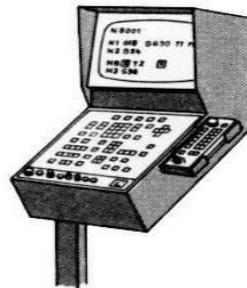


4. Manufacturing

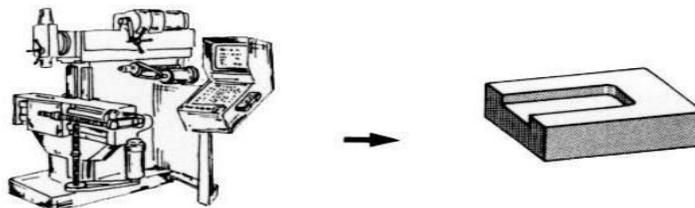

CNC TURNING

1. Write a manual part program for Linear Interpolation for the given part and execute.

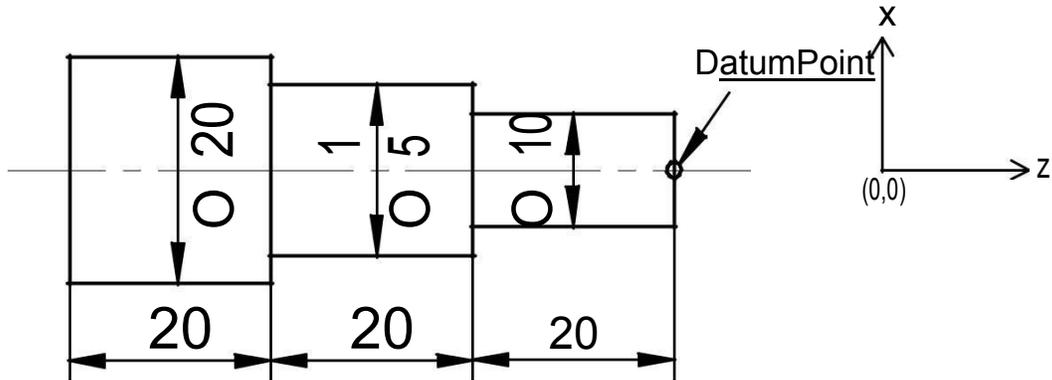

Note: All dimensions are in mm only


CNC Part Program:

```

O1011
G21 G98
G28 X0 Z0
M06 T0101
M03 S100
G00 X10 Z1 M08
G00 X7.5
G01 Z-40 F0.2
G00 X10 Z1
G00 X5
G01 Z-20 F0.2
G00 X10 Z1
G28 X0 Z0
M05 M09
M30
    
```

Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

2. Write a manual part program for Taper turning for the given part and execute.

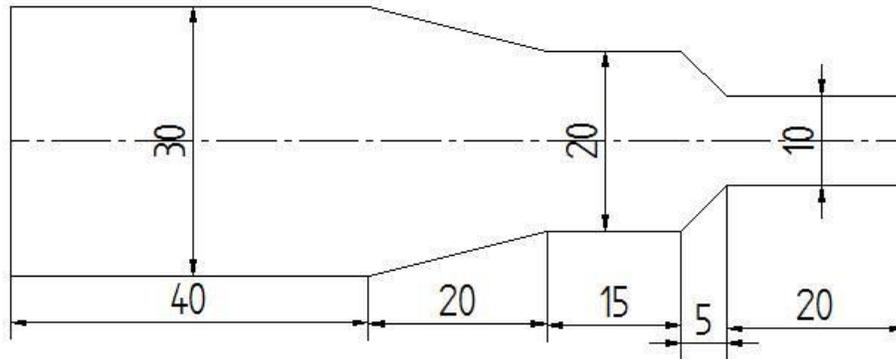


Note: All dimensions are in mm only

CNC Part Program:

```
O1012
G21 G98
G28 X0 Z0
M06 T0101
M03 S100
G00 X15 Z1 M08
G00 X10
G01 Z-40 F0.2
G00 X15 Z1
G00 X5
G01 Z-20 F0.2
G00 X15 Z1
G00 X10 Z-40
G01 X15 Z-60 F0.2
G00 X15 Z1
G00 X5 Z-20
G01 X10 Z-25 F0.2
G00 X15 Z1 G28 X0 Z0
M05 M09
M30
```

 C.I.T		Department of ME	
Particulars	Max. Marks	Marks Obtained	
Preparation	05		
Performance	10		
Viva -Voce	05		
Result/Output	05		
Total	25		
Student Signature with date	Staff Signature with date		

3. Write a manual part program on Chamfering & Step turning for the given part and execute.

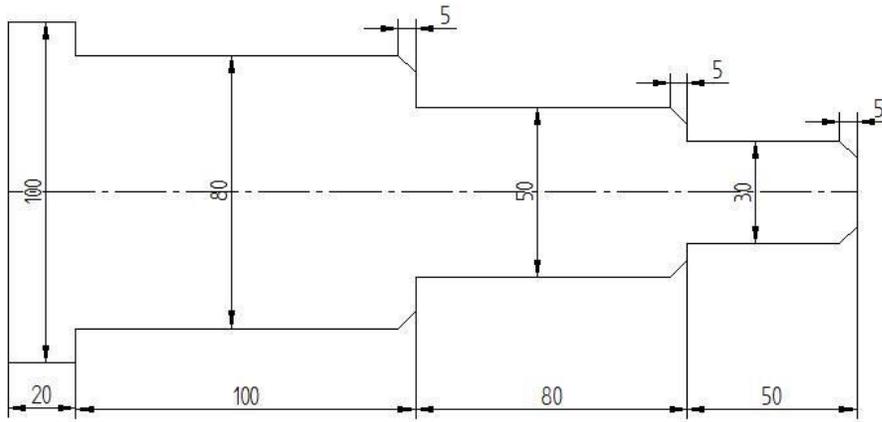


Note: All dimensions are in mm only

CNC Part Program:

```
O1013
G21 G98
G28 X0 Z0
M06 T0101
M03 S100
G00 X50 Z1 M08
G00 X40
G01 Z-230 F0.2
G00 X50 Z1
G00 X25
G01 Z-130 F0.2
G00 X50 Z1
G00 X15
G01 Z-50 F0.2
G00 X50 Z1
G00 X40 Z-135
G01 X35 Z-130 F0.2
G00 X50 Z1
G00 X25 Z-55
G01 X20 Z-50 F0.2
G00 X50 Z1
G00 X15 Z-5
G01 X10 Z0 F0.2
G00 X50 Z1
G28 X0 Z0
M05 M09
M30
```

C.I.T		Department of ME	
Particulars	Max. Marks	Marks Obtained	
Preparation	05		
Performance	10		
Viva -Voce	05		
Result/Output	05		
Total	25		
Student Signature with date	Staff Signature with date		

4. Write a manual part program on fillet & Step turning for the given part.

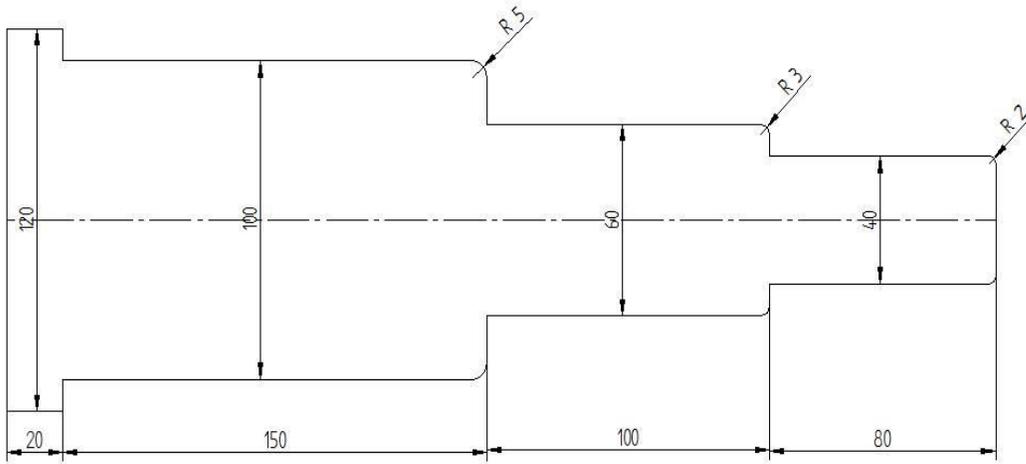

Note: All dimensions are in mm only


CNC Part Program:

```

O1014
G21 G98
G28 X0 Z0
M06 T0101
M03 S100
G00 X60 Z1 M08
G00 X50
G01 Z-330 F0.2
G00 X60 Z1
G00 X30
G01 Z-180 F0.2
G00 X60 Z1
G00 X20
G01 Z-80 F0.2
G00 X60 Z1
G00 X50 Z-185
G02 X45 Z-180 R5
G00 X60 Z1
G00 X30 Z-83
G02 X27 Z-80 R3
G00 X60 Z1
G00 X20 Z-2
G02 X18 Z0 R2
G00 X60 Z1
G28 X0 Z0
M05 M09
M30
    
```

C.I.T		Department of ME	
Particulars	Max. Marks	Marks Obtained	
Preparation	05		
Performance	10		
Viva -Voce	05		
Result/Output	05		
Total	25		
Student Signature with date	Staff Signature with date		

5. Write a manual part program for the given profile and execute.

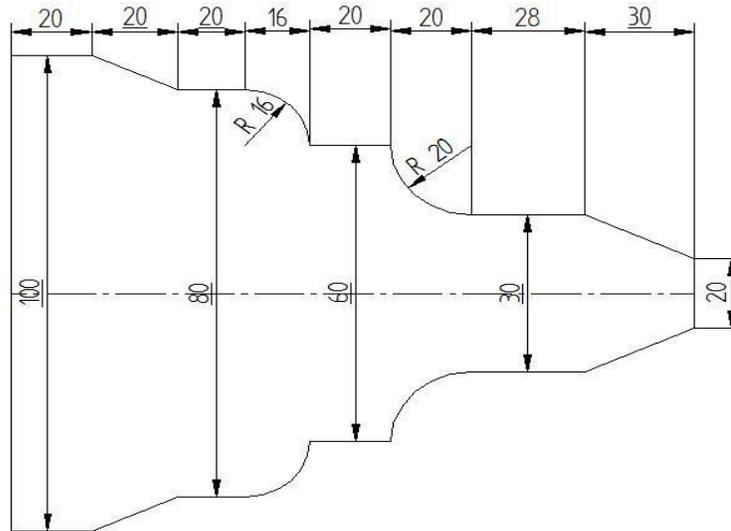

Note: All dimensions are in mm only


CNC Part Program:

```
O1015
G21 G98
G28 X0 Z0
M06 T0101
M03 S100
G00 X50 Z1 M08
G00 X40
G01 Z-134 F0.2
G00 X50 Z1
G00 X30
G01 Z-98 F0.2
G00 X50 Z1
G00 X15
G01 Z-58 F0.2
G00 X50 Z1
G00 X40 Z-134
G01 X50 Z-154 F0.2
G00 X50 Z1
G00 X30 Z-98
G03 X40 Z-114 R16
G00 X50 Z1
G00 X15 Z-58
G02 X30 Z-78 R20
G00 X50 Z1
```

```
G00 X10
G01 X15 Z-30 F0.2
G00 X50 Z1
G28 X0 Z0
M05 M09
M30
```

Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

6. Write a manual part program for the given profile and execute.

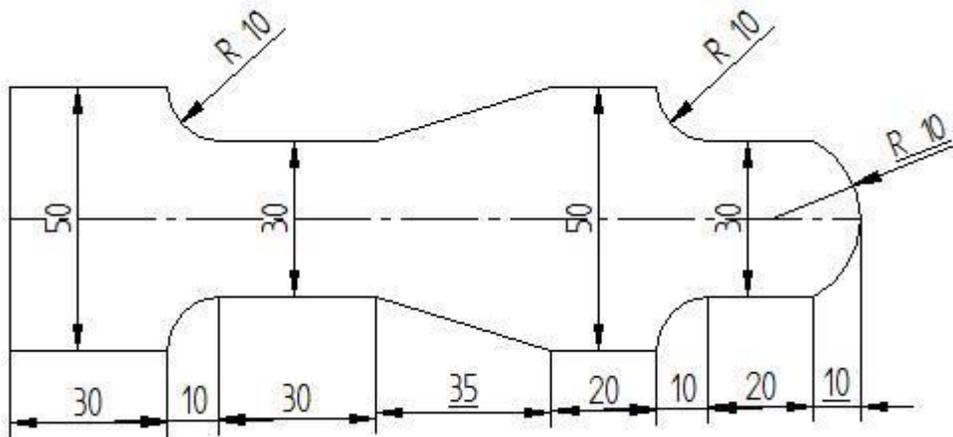

Note: All dimensions are in mm only


CNC Part Program:

```
O1016
G21 G98
G28 X0 Z0
M06 T0101
M03 S100
G00 X25 Z1 M08
G00 X15
G01 Z-30 F0.2
G00 X25 Z1
G00 X25 Z-60
G01 X15 Z-95 F0.2
G00 X25 Z-95
G00 X25 Z1
G00 X25 Z-95
G00 X15 Z-95
G01 X15 Z-125 F0.2
G00 X25 Z-125
G00 X25 Z1
G00 X25 Z-125
G00 X15 Z-125
G02 X25 Z-135 R10
G00 X25 Z-135
G00 X25 Z1
G00 X15 Z-30
G02 X25 Z-40 R10
G00 X25 Z1
G00 X15 Z-10
```

```
G02 X0 Z0 R10
G00 X25 Z1
G28 X0 Z0
M05 M09
M30
```

Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

7. Write a manual part program for the given profile and execute.

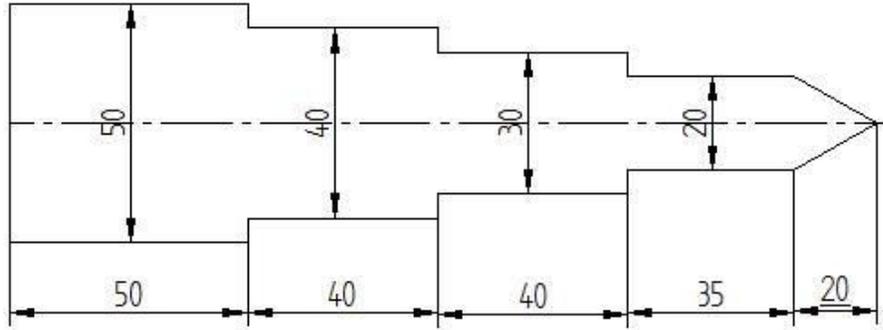

Note: All dimensions are in mm only


CNC Part Program:

```
O1017
G28 X0 Z0
M06 T0101
M03 S100
G00 X25 Z1 M08
G00 X20
G01 Z-135 F0.2
G00 X25 Z1
G00 X15
G01 Z-95 F0.2
G00 X25 Z1
G00 X10
G01 Z-55 F0.2
G00 X25 Z1
G00 X10 Z-20
G01 X0 Z0 F0.2
G00 X25 Z1
G28 X0 Z0
M05 M09
M30
```


 C.I.T		Department of ME	
Particulars	Max. Marks	Marks Obtained	
Preparation	05		
Performance	10		
Viva -Voce	05		
Result/Output	05		
Total	25		
Student Signature with date	Staff Signature with date		

PRACTICE PROGRAMS [CNC TURNING]


8.

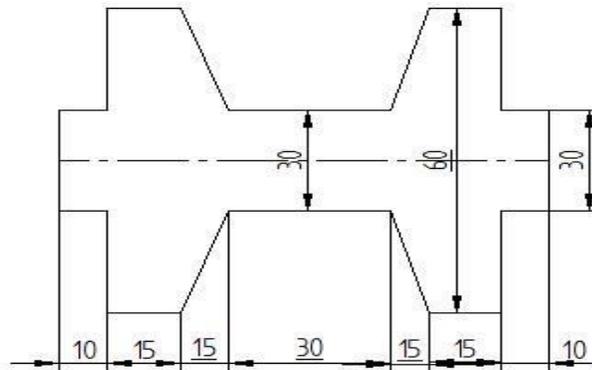

9.

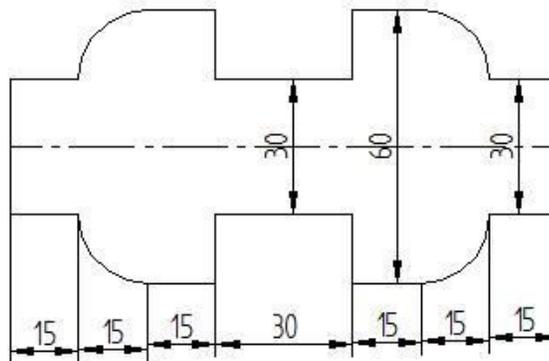


10.

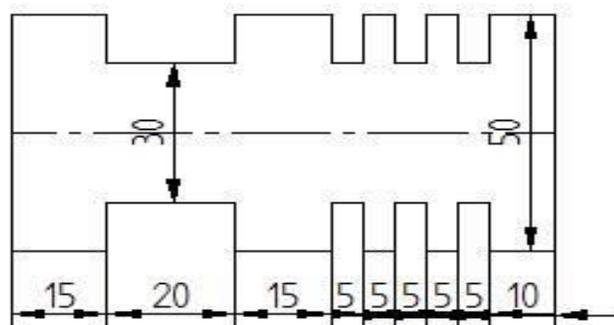

Note: All dimensions are in mm only

CNC MILLING

1) Write a manual part program for Slotting operation for the component as shown in drawing and execute.

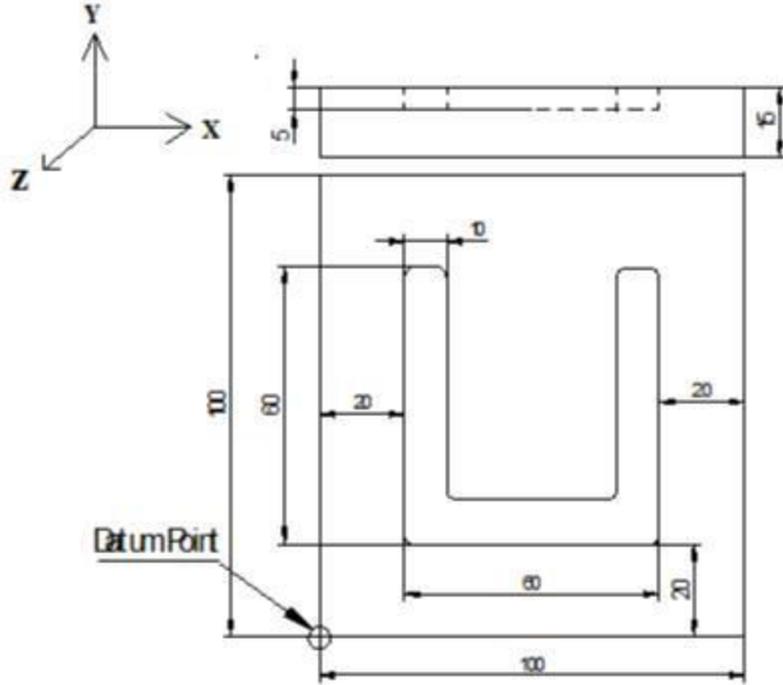

Material – Mild Steel,

Operation - Slotting

Billet size – 100 x 100 x 15mm

Tool – Radiused end mill Φ 10
mm

Note: All dimensions are in mm only


CNC Part Program:

```

O1021
G21 G98
G28 X0 Y0 Z0
M06 T0101
M03 S100
G00 X25 Y75 Z5 M08
G01 Z-5 F0.2
Y25
X75
Y75
G00 Z5
G28 X0 Y0 Z10
M05 M09
M30
    
```

Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

2) Write a manual part program for Drilling operation for the component as shown in drawing.

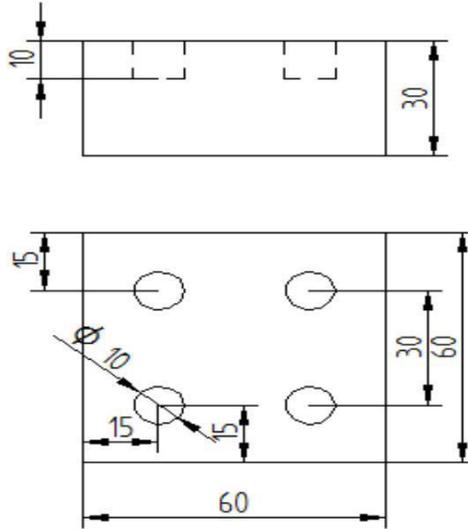

Note: All dimensions are in mm only

Material – Mild Steel,

Operation - Drilling

Billet size – 60 x 60 x 30mm


Tool – Slot drill Φ 10 mm

CNC Part Program:

O1022
 G21 G98
 G28 X0 Y0 Z0
 M06 T0101
 M03 S100
 G00 X15 Y15 Z5 M08
 G01 Z-10 F0.2
 G00 Z5
 G00 X15 Y45
 G01 Z-10 F0.2
 G00 Z5
 G00 X45 Y45
 G01 Z-10 F0.2
 G00 Z5
 G00 X45 Y15
 G01 Z-10 F0.2
 G00 Z5
 G28 X0 Y0 Z0
 M05 M09
 M30

Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

3) Write a manual part program for the profile as shown in the drawing and execute.

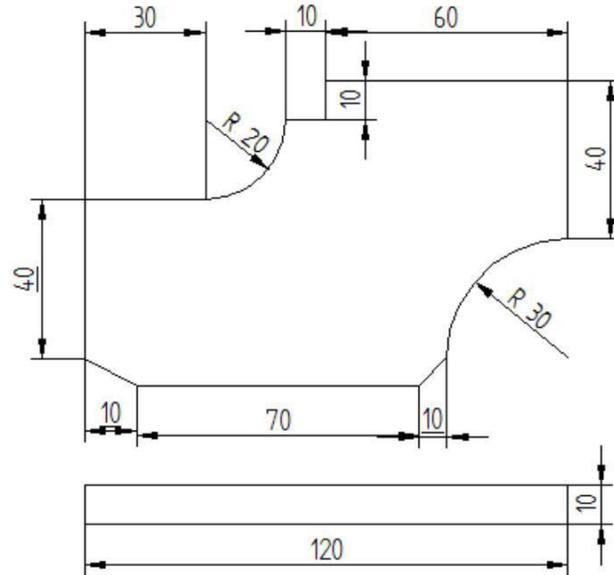

Note: All dimensions are in mm only

Material – Mild Steel,

Operation – Milling

Billet size – 120 x 80 x 10mm


Tool – Radiused end mill Φ 5mm

CNC Part Program:

O1023
 G21 G98
 G28 X0 Y0 Z0
 M06 T0101
 M03 S100
 G00 X0 Y10 Z5 M08
 G01 Z-10 F60
 X10 Y0
 X80
 X90 Y10
 G02 X120 Y40 Z-10 R30
 G01 X120 Y80 Z-10 F60
 X60 Y80
 X60 Y70
 X50 Y70
 G02 X30 Y60 Z-10 R20
 G01 X0 Y60 Z-10 F60
 X0 Y10
 G28 X0 Y0 Z0
 M05 M09
 M30

Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

4) Write a manual part program for the profile as shown in the drawing and execute.

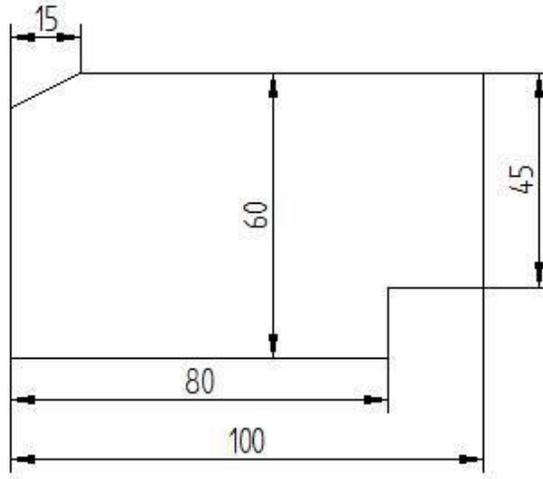

Note: All dimensions are in mm only

Material – Mild Steel,

Operation – Milling

Billet size – 100 x 60 x 15mm


Tool – Radiused end mill Φ 10mm

CNC Part Program:

```
O1024
G21 G98
G28 X0 Y0 Z0
G41 M06 T0101
M03 S600
G00 X0Y0 Z5 M08
G01 Z-10 F0.2
G01 X0 Y45
G01 X15 Y60
G01 X100
G01 Y15
G01 X80
G01 Y0
G01 X0
G0 Z5
G28 X0 Y0 Z0
M05M09
M30
```

Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

5) Write a manual part program for the profile as shown in the drawing and execute.

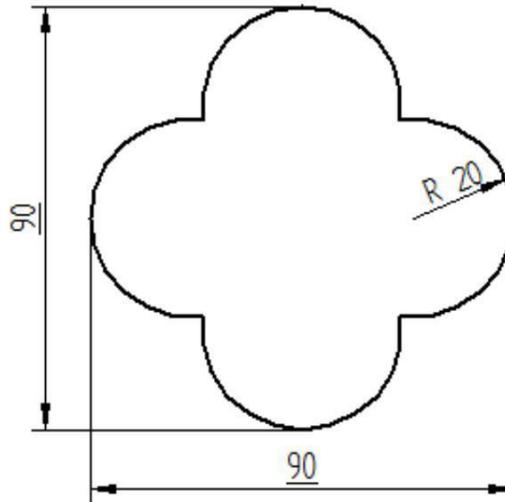

Note: All dimensions are in mm only

Material – Mild Steel,

Operation – Milling

Billet size – 100 x 60 x 15mm


Tool – Radiused end mill Φ 10mm

CNC Part Program:

O1025
 G21 G98
 G28 X0 Y0 Z0
 G42 M06 T0101
 M03 S100
 G00 X20 Y20 M08
 G01 Z-10 F0.2
 G03 X60 Y20 R20
 G03 X60 Y60 R20
 G03 X20 Y60 R20
 G03 X20 Y20 R20
 G00 Z5
 G28 X0 Y0 Z0
 M05 M09
 M30

Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

6) Write a manual part program for the profile as shown in the drawing and execute.

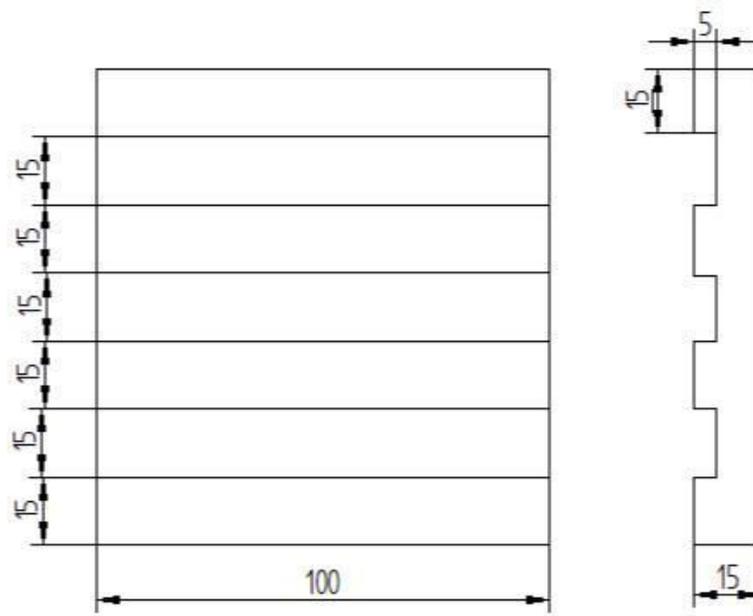

Note: All dimensions are in mm only

Material – Mild Steel,

Operation – Slotting

Billet size – 100 x 105 x 15mm


Tool – slot drill Φ 15mm

CNC Part Program:

O1027
 G21 G98
 G28 X0 Y0 Z0
 M06 T0101
 M03 S100
 G00 X-8 Y22.5 M08
 G01 Z-5 F0.2
 G01 X108 F0.2
 G00 Y52.5
 G01 X-8 F0.2
 G00 Y82.5
 G01 X108 F0.2
 G00 Z10
 G28 X0 Y0 Z10
 M05 M09
 M30

Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

7) Write a manual part program for the profile as shown in the drawing and execute.

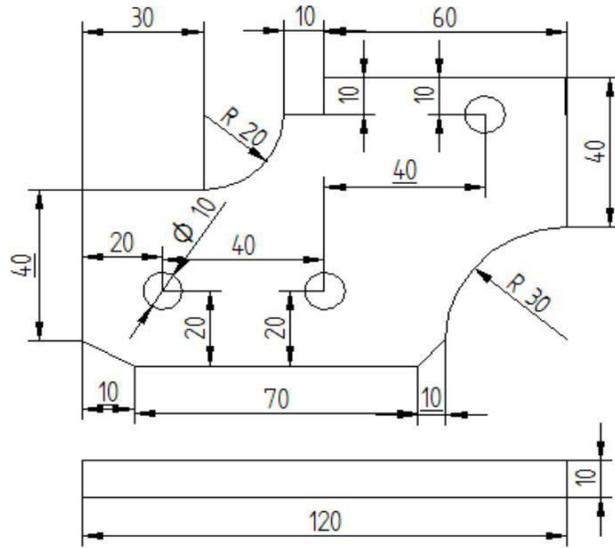

Material – Mild Steel,

Operation – milling & drilling

Billet size – 120 x 80 x 10mm

Tool – slot drill Φ 10mm

Note: All dimensions are in mm only


CNC Part Program:

O1027
 G21 G98
 G28 X0 Y0 Z0
 M06 T0101
 M03 S600
 G00 X0 Y10 Z5 M08
 G01 Z-10 F60
 X10 Y0
 X80
 X90 Y10
 G02 X120 Y40 Z-10 R30
 G01 X120 Y80 Z-10 F60
 X60 Y80
 X60 Y70
 X50 Y70
 G02 X30 Y60 Z-10 R20
 G01 X0 Y60 Z-10 F60
 X0 Y10
 G00 X0 Y0 Z5
 G00 X25 Y20 Z5
 G01 Z-10 F60
 G00 Z5
 G00 X65 Y20 Z5
 G01 Z-10 F60
 G00 Z5

G00 X105 Y70 Z5
 G01 Z-10 F60
 G00 Z5
 G28 X0 Y0 Z0
 M05 M09
 M30


Particulars	Department of ME	
	Max. Marks	Marks Obtained
Preparation	05	
Performance	10	
Viva -Voce	05	
Result/Output	05	
Total	25	
Student Signature with date	Staff Signature with date	

8.

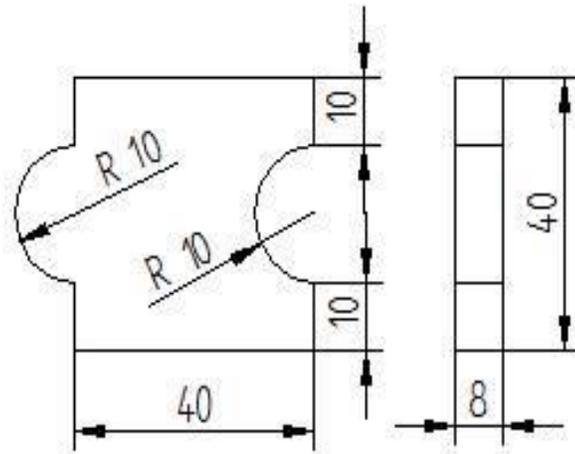


Note: All dimensions are in mm only

9.

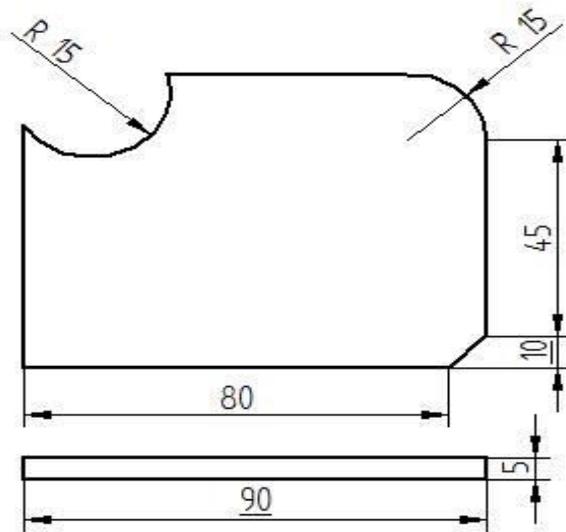

Note: All dimensions are in mm only


10.

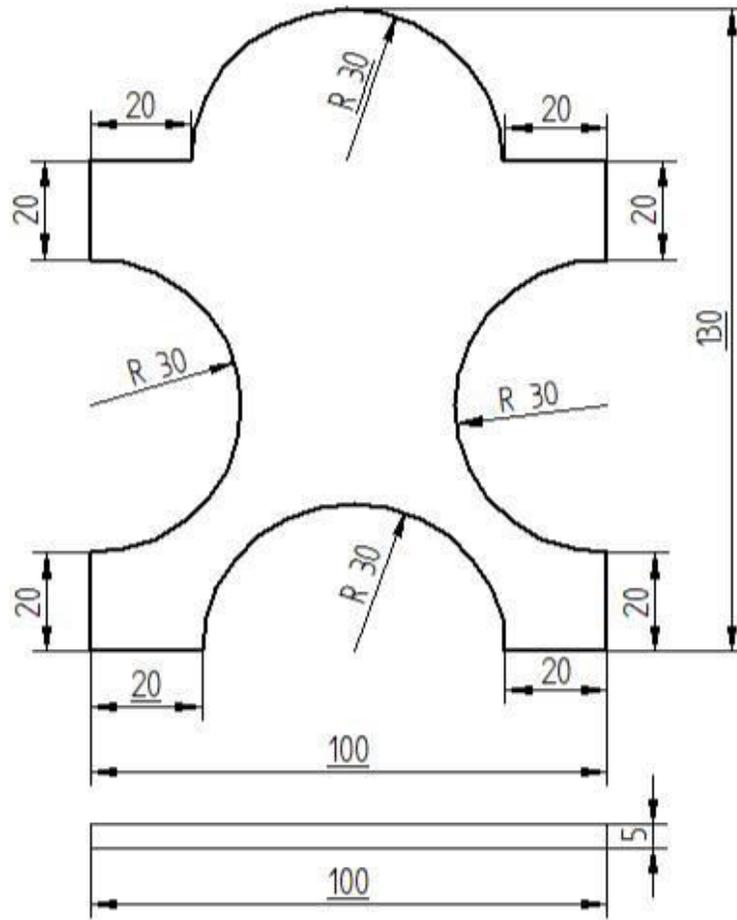

Note: All dimensions are in mm only

TO GENERATE THE PROGRAM

8 steps in CAPSTURN/CAPSMILL NC programming

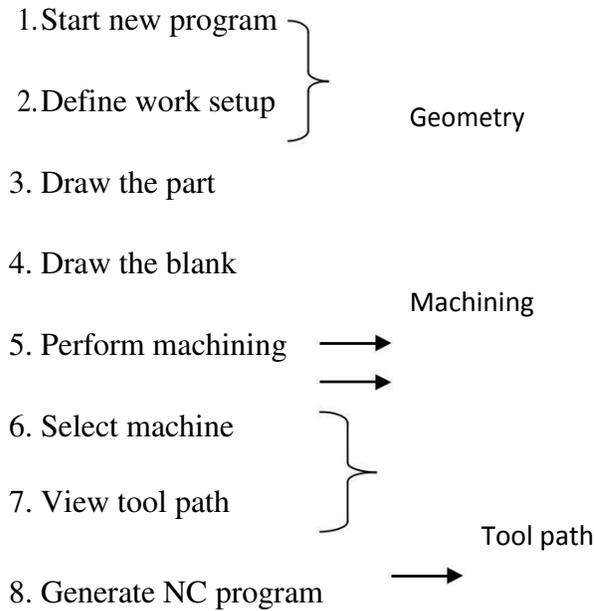

1. Start new program

Double click on the CAPSTURN icon

Or

Select start- program –CADEM –CAPSTURN

2. Define work setup

Setup data is required for machining, and documentation is related to the details of the program. The work setup data is divided into

Setup data 1,

Setup data 2 and

Documentation.

Entering the setup data I mandatory, while documentation is optional.

3. Draw the part

Draw-use the drawing tools to construct the geometry of the part

Draw-define part – create part shape

4. Draw the blank

Draw –define blank

5. Perform machining

Switch to the machining menu clicking on the machining tab

Select appropriate machining operation and define tool details used for that operation

6. Select machine

Select suitable machine from the available list

7. View tool path.

Switch to tool path mode by clicking on tool path tab

Select tool path-start

8. Generate NC program

Click on NC PROGRAM ON THE menu bar

QUESTIONS

1. What is CAD?

CIM & Automation lab (10MEL78)

37
VII SEM, ME

Computer-aided design (CAD) is the use of computer systems to assist in the creation, modification, analysis, or optimization of a design.

2. What is CAM?

Computer-aided manufacturing (CAM) is the use of computer software to control machine tools and related machinery in the manufacturing of work pieces.

3. What is CAE?

Computer-aided engineering (CAE) is the broad usage of computer software to aid in engineering tasks.

4. What is Automation?

Automation is the use of machines, control systems and information technologies to optimize productivity in the production of goods and delivery of services.

5. What are the benefits of CAD?

- Improved engineering productivity
- Reduced engineering personnel requirements
- Customer modifications are easier to make
- Faster response to requests for quotations
- Minimized transcription errors
- Improved accuracy of design
- Improved productivity in tool design

6. What is design process?

- Define the Problem
- Do Background Research
- Specify Requirements
- Create Alternative Solutions
- Choose the Best Solution
- Do Development Work
- Build a Prototype
- Test and Redesign

7. What is geometric modeling?

Geometric modeling is a branch of applied mathematics and geometry that studies methods and algorithms for the mathematical description of shapes.

8. Advantages of CAD/CAM?

- Savings in geometry definition.
- Immediate visual verification.
- Use of automatic programming routines.
- One-of-a-kind jobs.
- Integration with other related functions.

9. Define NC?

Numerical control (NC) is the automation of machine tools that are operated by abstractly programmed commands encoded on a storage medium.

10. What are the basic components of NC system?

An operational numerical control system consists of the following three basic components:

1. Program of instructions
2. Controller unit, also called a machine control unit (MCU)
3. Machine tool or other controlled process


11. What is NC procedure?

- Process planning.
 - Part programming
-
- Tape preparation.
 - Tape verification.
 - Production.

12. What is cutter offsetcompensation?

An offset used on the mill that accounts for variations in tool diameter. Cutter compensation is necessary only for tools that travel in the X- or Y-axes.

13. Discuss NC coordinate system?

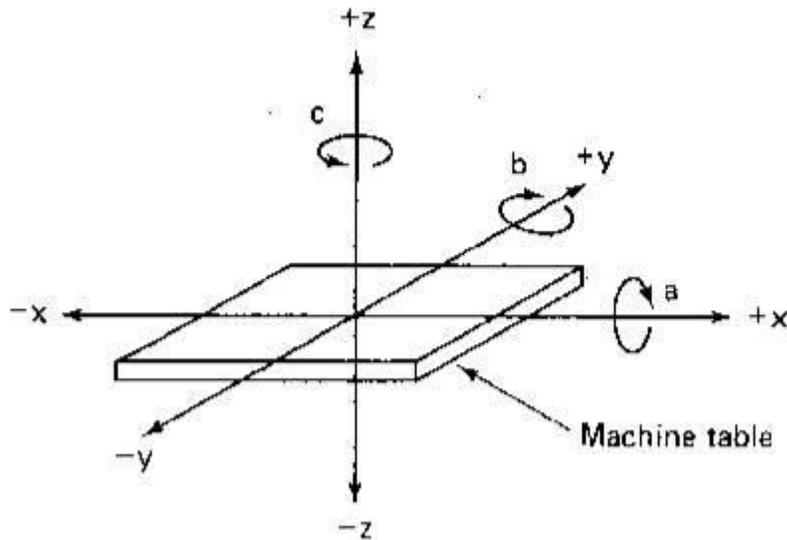

14. What is workpiece Zero point?

The origin of both the work piece coordinates system and the part program for a particular work piece. Work piece zero, commonly called program zero, is unique to each work piece design and is selected by a part programmer.

15. What is Machine zero point?

The origin of the machine coordinates system located above the far upper right-hand corner of the mill table. The unchangeable machine zero point is also known as the home position.

16. What Home zero point?

The origin of the machine coordinate system located above the lathe spindle and to the far upper right-hand corner of the lathe work area. The unchangeable machine zero point is also known as the home position.

17. Applications of NC systems?

- Batch and high volume production
- Repeat and repetitive order
- Complex part geometries
- Many separate operations on one part

18. Advantages and disadvantages of NC machine?

Advantages

- Part program tape and tape reader
- Editing the program
- Metric conversion

- Highly flexible
- Easier programming

Disadvantages

- Higher investment cost.
- Higher maintenance cost
- Finding and/or training NC personnel

19. What does N Word stands for?

20. What does G word stands for?

G - Preparatory function

21. What does M Word stands for?

M - Miscellaneous function

22. What does T word stands for?

T - Tool Designation

23. Steps in computer assisted part programming?

- Typically starts with the receipt (by the manufacturing department) of a design in the form of a CAD/NC drawing or model
- Review of the model by a production planner and then design/selection of the tools
- Selection of cutting process parameters (cutting conditions, direction of cut, roughing and finishing, etc)
- Generation of cutter path
- Verification of the cutter path by replaying the path – computer assists the programmer by animating the entire path, showing the location of the cutter visually and displaying the XYZ coordinates

24. What is robot?

A robot is a mechanical or virtual agent, usually an electro-mechanical machine that is guided by a computer program or electronic circuitry.

25. Physical configurations of robot.

- Cartesian configuration

- Cylindrical configuration
- Polar configuration
- Jointed-arm configuration

26. Basic robot motions.

1. Arm and body motions
 - Vertical traverse
 - Radial traverse
 - Rotational traverse
2. Wrist Motion
 - Wrist swivel
 - Wrist bend
 - Wrist yaw

27. Robot programming language.

- The VALTM Language
- The MCL Language

28. Basic commands for robot

MOVE, HERE, APPROACH, DEPART, MOVE PATH, SPEED, EXECUTE PROGRAM

29. Applications of robot

- Hazardous work environment for humans
- Repetitive work cycle
- Difficult handling task for humans
- Multi shift operations
- Infrequent changeovers
- Part position and orientation are established in the work cell

30. Advantages and disadvantages of robot

Advantages

- Robotics and automation can, in many situation, increase productivity, safety,
- efficiency, quality, and consistency of Products
- Robots can work in hazardous environments
- Robots need no environmental comfort

- Robots work continuously without any humanity needs and illnesses
- Robots have repeatable precision at all time

Disadvantages

- Robots lack capability to respond in emergencies, this can cause:
 - Inappropriate and wrong responses
 - A lack of decision-making power
 - A loss of power
- Robots may have limited capabilities in
 - Degrees of Freedom
 - Sensors
- Robots are costly, due to
 - Initial cost of equipment
 - Installation Costs

31. What is FMS?

A flexible manufacturing system (FMS) is a manufacturing system in which there is some amount of flexibility that allows the system to react in the case of changes, whether predicted or unpredicted.

32. What is automatic storage and retrieval system?

An automated storage and retrieval system (ASRS or AS/RS) consists of a variety of computer-controlled systems for automatically placing and retrieving loads from defined storage locations.

33. What is meant by canned cycle (or) fixed cycle? Give an example.

A canned cycle simplifies a program by using a few blocks containing G code functions to specify the machining operations usually specified in several blocks.

Ex. Drilling (G81), Peck drilling (G83), Tapping (G84), Boring (G86)

EXPERIMENT NO: 01

Objective

Introduction to Computer Integrated Manufacturing (CIM) Lab.

Introduction

Computer Integrated Manufacturing (CIM) embodies three components essential to the implementation of flexible design & manufacturing -- the means for information storage, retrieval, manipulation and presentation; the mechanisms by which to sense state, and modify substance; and the methodologies by which to unite them. The Computer Integrated Manufacturing Laboratory (CIM Lab), provides students and research associates with necessary facilities to contribute to the success of this goal.

Objective

It is the state-of-the-art laboratory consisting of various equipment classes including material processing class - computer numerically (CNC) controlled machine centers (mill and lathe), material handling class - industrial robots, material transportation class, conveyor system, and material inspection class, vision based system (Gigabit Ethernet Cameras). The materials are stored in AS/RS (automated storage and retrieval system). The objective of this CIM LAB is to introduce these all equipment.

Procedure

With the inception of Computer Numerically Controlled (CNC) machines into manufacturing setup, precise and reliable machining without human intervention during the machining process has enabled reduction in operational hazards and in job time through automated machining and tool changing. CNC SIMULATOR for virtual simulation is used whether it's any problem in coding. The CNC has currently 2-Axes Lathe with automatic 8 tool turret and a 3-Axes CNC milling with automatic 24 tool changer. Both machines are of industrial grade, optimizing tool path, and increase lead time whereas enable researchers to study phenomena relevant to machining.

Conclusion

The main purpose of the CIM LAB is too familiar with automation, CNC Milling, AS/RS machine, Scorbot and Cell Setup etc. These all system helps the students how to control their axis through software or teach pendent. CIM Setup including AS/RS, Scorbot and a conveyer that regulate the parts motion on different stations in fully automatic system.

EXPERIMENT NO : 02

Objective

Introduction to OPEN CIM Software

Apparatus

1. Laptop
2. Software (OPEN CIM)

Theory

Open-CIM software provides unique industrial capabilities not found in other educational CIMs:

- Open-CIM “feels” familiar to first-time users because it is based on the standard Windows

Graphic user interface.

- Open-CIM allows for targeted training at a given station or device.
- Open-CIM is realistic because it uses equipment found in actual industrial CIMs.
- Open-CIM resembles industrial CIMs in its ability to grow by using distributed processing at each production station. Distributed processing also makes for a more robust system. Even if the PC performing the central manager function goes down, each machine can still be operated in a stand-alone mode.
- Open-CIM uses a sophisticated network of PCs which allows various devices to perform multiple operations simultaneously. This network also allows CIM devices to communicate with each other.
- Open-CIM provides you with a powerful, yet flexible report generator. This utility program allows you to access nine types of predefined reports or gives you the option of creating your own user-defined reports.
- Open-CIM uses the latest object oriented techniques in:
 - Defining the CIM Layout: Click on a Graphic object and drag it to the appropriate location on the CIM layout screen (e.g. Drag a robot in order to place it beside a CNC machine).
 - Defining an Object’s Properties: Click on an object to set its properties, e.g. the type of parts a machine can handle.

Graphic Production Tracking: Uses Graphic objects to simulate CIM operation on screen.

- Open-CIM allows you to run a production simulator on a PC to observe results without actually operating the CIM production line.
- Open-CIM provides the opportunity to observe how a set of diverse hardware components work together in a real-world environment.
- Open-CIM is more comprehensive than other limited function CIMs. It can use a variety of equipment including:
 - A variety of robots
 - CNC machines
 - Quality control devices (machine vision, laser scan meter, height gauge)

- Automated storage and retrieval systems (ASRS)
- Peripheral devices (barcode scanner, X-Y table, electric screwdriver, etc.)
- Custom devices by allowing you to easily set up your own device interfaces
- Open-CIM offers Graphic production tracking allowing you to observe each production operation on a central display.
- Open-CIM provides an open environment for advanced users who want to:
 - Add their own devices
 - Design their own products
 - Interface their own software (e.g. MRP and cost analysis)
 - Analyze CIM production data
- Open-CIM is a robust system that enables recovery from errors without the need to reset the entire cim cell.

Results

This software at a PC coordinates the functioning of all devices in the cell using a LAN.

Comments

(The software at) a PC which is connected to each device at a station and has a communication link with the CIM Manager. A set of Open-CIM device drivers run on this PC. Each driver controls the operation of a device at the station in response to commands from the CIM Manager and other CIM elements.

EXPERIMENT NO : 3

Objective

Making the tutorial CIM setup in OPEN CIM Software

Apparatus

1. OPEN CIM Software
2. Computers


Theory

Accessing the Project Manager

- After the Open CIM installation is complete, the Project Manager icon is displayed on your desktop window and Start menu.

To log in to the Project Manager application:

- From the windows Start menu, select All Programs | **Open CIM** |

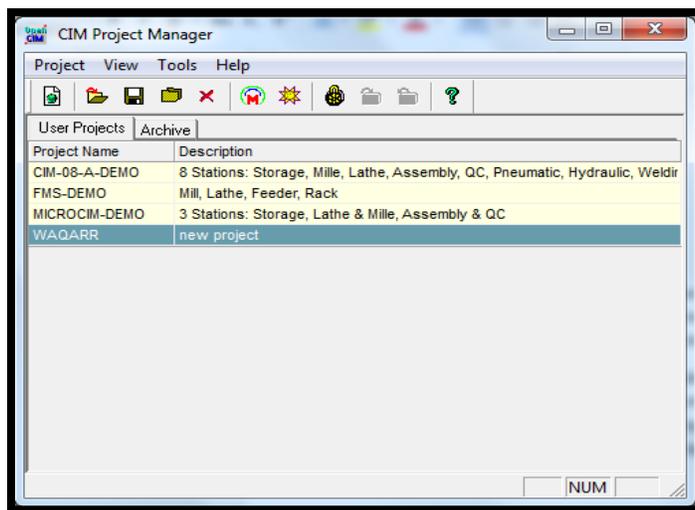

Project Manager Main Window

The CIM Project Manager window, contains the following elements, each of which is described in the sections that follow.

- Project Manager Menu Bar
- Project Manager Toolbar
- Archive Tab
- User Projects Tab

- 3D Model Display Area

Project Manager Toolbar



Following are the icons of the project manager toolbar



Option	Description
	New: Enables you to add a new project to the list.
	Import: Enables you to import an existing CIM Project from a local directory. This option is enabled from the User Projects tab only.
	Save As: Enables you to save the selected project under a new name. The new project is displayed in the list of projects in the User Projects tab.
	Back Up: Enables you to export a project to a specified directory for backup purposes. You can export projects from both the User Projects and Archive tabs.


Procedure

- First of all we open the CIM software using this icon.
- After this we will get a window of CIM project manager.
- Place a table from user objects and 2 workstations and one CIM manger on the table.
- Place chairs from user objects.
- Place conveyor which is connected through robot with CNC machine.
- Place ASRS-36 from user objects.
- Place another machine near CNC.
- Now after this we will start our project by selecting project under NEW file.
- And we save a project with certain Name. Step by step procedure is given below

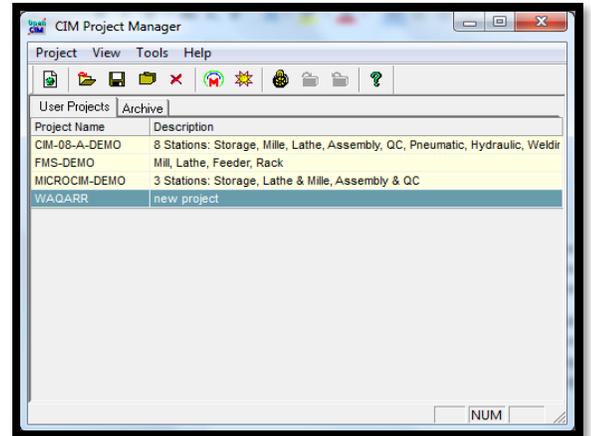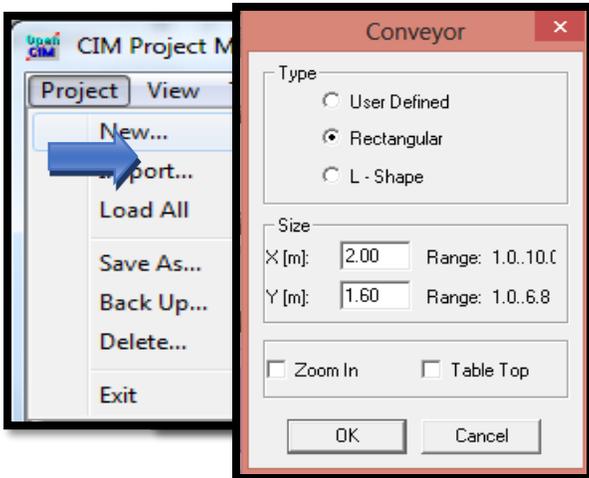


Open CIM Setup


- After selecting a project we open it in CIM setup by clicking on this icon.
- Now we start placing the objects according to our required layout.
- First of all we place all the tables as shown below from the object menu.
- Now we select the table option and put it at the desire place.
- After this we will place the **work station** and the **robot ER9** from the object menu
- After this now we place the **CNC mill machine** and also the **conveyor** on the table

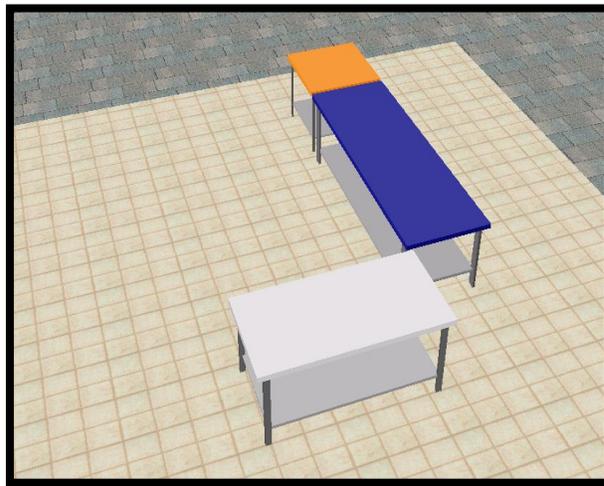




- By selecting the conveyor we choose the rectangular with zoom in and table on top.

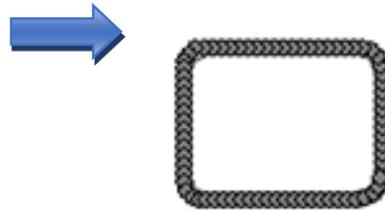

- Then we further select the work station on the conveyor. As given below;

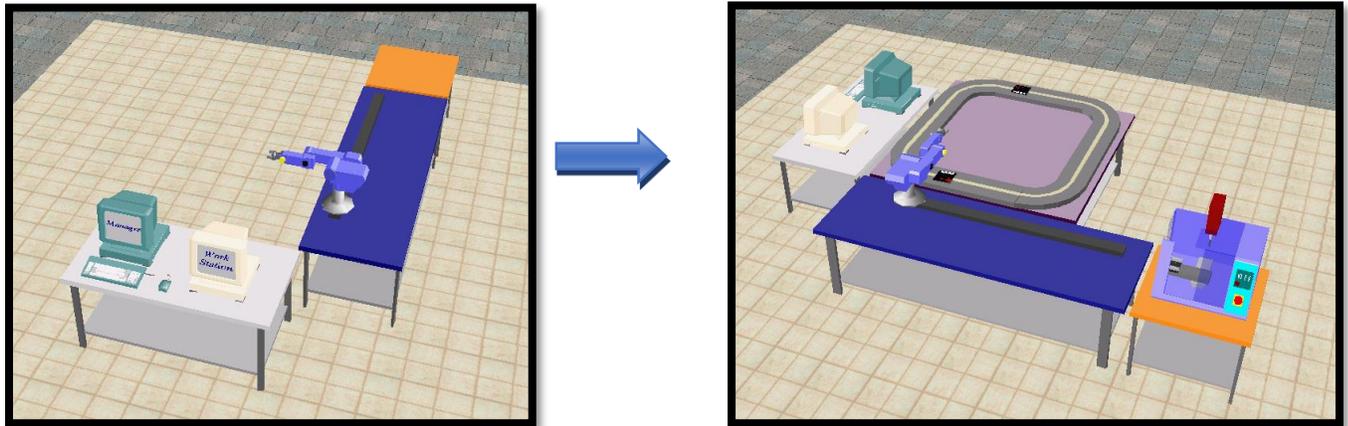

- Then after this we will place a storage device.
- Then we place the **ACL** and **SCOREBASE** and give them connectivity with the relevant workstation.
 - ✓ For each robot at the station (including the ASRS36): add an ACL device driver.
 - ✓ For a CNC machine (lathe/mill): add a CNC device driver.
 - ✓ For the Conveyor: add a PLC device driver. Place it at Station 1.As shown below

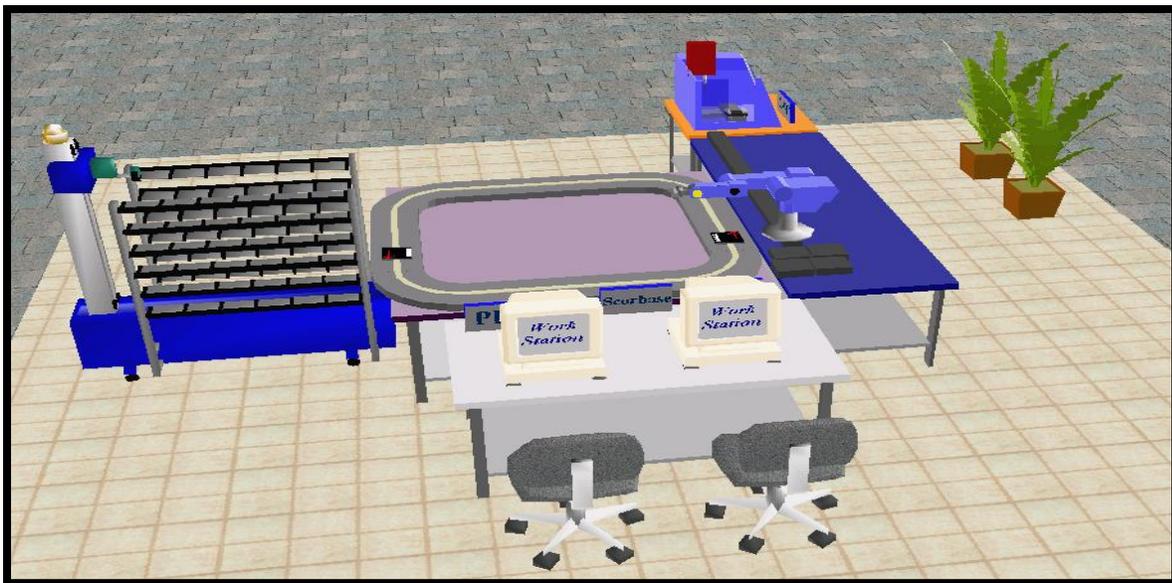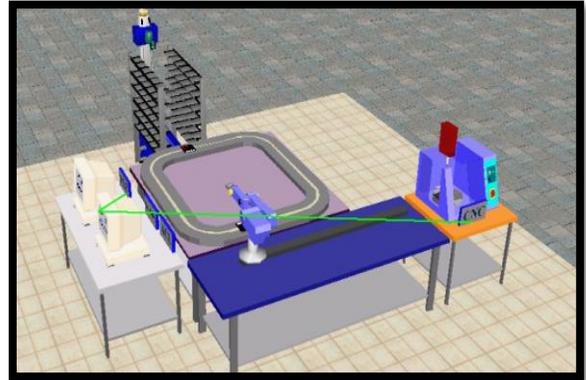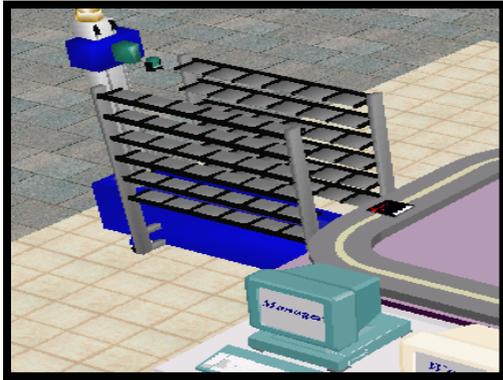

- Now we place the ACL, PLC and CNC and give them connectivity with the relevant workstation.
- The whole layout is shown below and ready to run in Open CIM Manager.

Results and Conclusion

OpenCIM provides an open environment for advanced users who want to:

- Add their own devices

- ✚ Design their own products
- ✚ Interface their own software (e.g.MRP and cost analysis)
- ✚ Analyze CIM production data

Comments

The software at a PC which coordinates the functioning of all devices in the cell using a LAN.

SOURCE

web.uettaxila.edu.pk/CMS/SPR2015/ieCIMbs/labs%5CCIM%20Lab%20Manual.docx